

0930Z 06 MAR 66

S E C R E T

1	Idea	22
2	DISA	PS
3	DDISA	RB
4	DLEA	"
5	LD	
6	DD/SAT	
7	"	
8	DIR/CTA	

25X1A DIRECTOR

FROM: [REDACTED]

ACTION:

INFO:

PRIORITY

IN 91829

25X1A TOR: 0211Z 06 MAR 66

TO PRIORITY [REDACTED] INFO PRIORITY [REDACTED]

25X1A

25X1A FROM [REDACTED]

25X1A [REDACTED] IS UNABLE TO DETERMINE AT THIS TIME THE CAUSE OF ARTICLE 342'S ACCIDENT DUE TO INSUFFICIENT PARTS RECOVERED. SEARCH IS CONTINUING AT THIS TIME - IN AN EFFORT TO UNGROUND THE AIRCRAFT GEN LEDFORD HAS REQUESTED [REDACTED] ESTABLISH AN INSPECTION PROGRAM WHICH WILL INSURE THE INTEGRITY OF THE STRUCTURE OF THE ARTICLE.

25X1A

IT SHOULD BE NOTED THAT DETAILED ANALYSIS OF PARTS RECOVERED TO DATE DO NOT SHOW ANY PRIOR DAMAGE, CORROSION OR FATIGUE - ALSO MATERIAL CONDITION IS UP TO SPEC.

25X1A [REDACTED] WILL SEND A TEAM TO [REDACTED] WITH PORTABLE X-RAY, ULTRA SONIC EQUIP, DYE PENETRINT EQUIP & BORE SCOPE EQUIPMENT TO PERFORM THE FOLLOWING INSPECTION:

25X1A

1. INSPECT MAIN BH'D RING & LOWER LONGERON INTERSECTIONS
2. REMOVE 1 AT A TIME REPEAT 1 AT A TIME THE MAIN RING JOINT TENSION BOLTS INSPECT BY X-RAY & PORESCOPE BOLT HOLE & REPLACE TENSION BOLTS WITH NEW PART - ALL REMOVED BOLTS WILL BE TAGGED AS TO

S E C R E T

GROUP 1
EXCLUDED FROM AUTO-
MATIC DOWNGRADING
AND DECLASSIFICATION

REPRODUCTION BY OTHER THAN THE ISSUING OFFICE IS PROHIBITED. COPY NO.

25X1A

[REDACTED] (IN 91829)

S E C R E T

PAGE 3

(B) REMOVE ALL HEAT SHIELDS INSIDE FUES.

(C) REMOVE SUMP TANKS

(D) REMOVE FUEL SHUT OFF VALVES

(E) REMOVE FUEL/OIL HEAT EXCHANGER - SOME MISC PLUMBING WILL
HAVE TO BE REMOVED IN ORDER TO USE X-RAY, BUT THESE CAN BE

25X1A
25X1A REMOVED AT THE DIRECTION OF [REDACTED] TEAM

[REDACTED] TEAM WILL BE READY TO DEPART ZI ON TUESDAY MARCH 8,
1966 TEAM WILL HAND CARRY ALL TEST EQUIPMENT - NEW TENSION

25X1A BOLTS & OTHER MISC HARDWARE [REDACTED] FEELS WILL BE REQUIRED (THIS
INCLUDES PAINT FOR TOUCH UP)

25X1A
25X1A FOR [REDACTED] TEAM AS FOLLOWS:

[REDACTED]

25X1A
25X1A ALTERNATE FOR [REDACTED]

[REDACTED]

TEAM COULD BE AVAILABLE TO COVER [REDACTED] IF DESIRED - BEST TIME
ESTIMATE TO DO COMPLETE INSPECTION ON ONE ARTICLE
INCLUDING REASSEMBLY & PREFLIGHT AFTER TEAM ARRIVES IS
FOUR DAYS (LONG DAYS) - SOME WORK MAY BE ACCOMPLISHED
CONCURRENT ON TWO ARTICLES

25X1A

END OF MESSAGE

S E C R E T